




Section Thru Rake at Cold-Form Rafter

DRAWING NO.

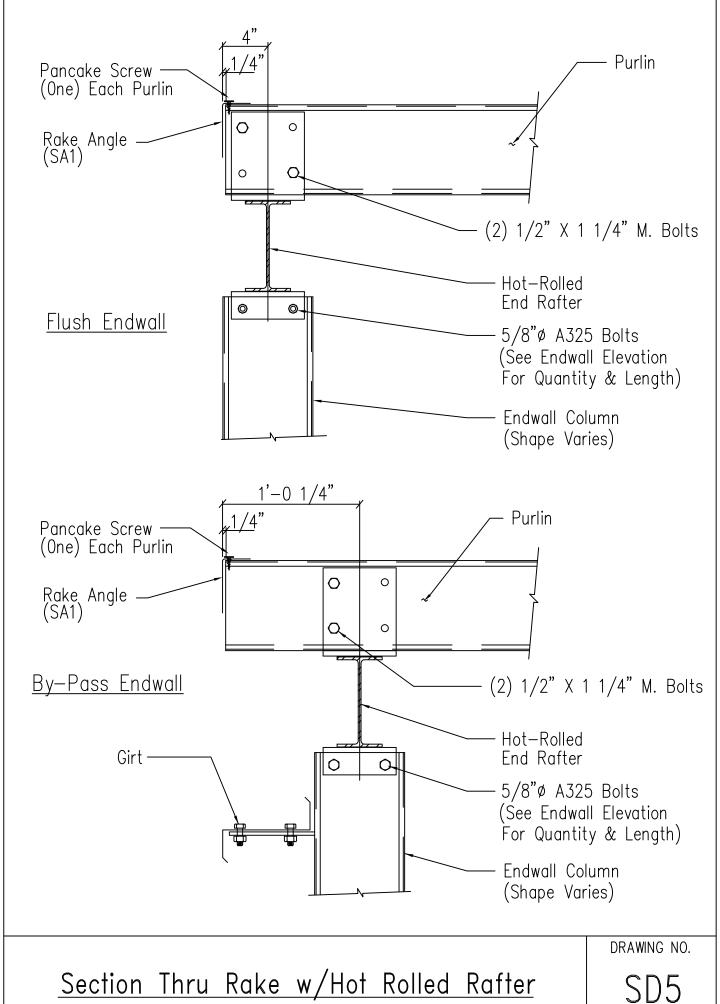

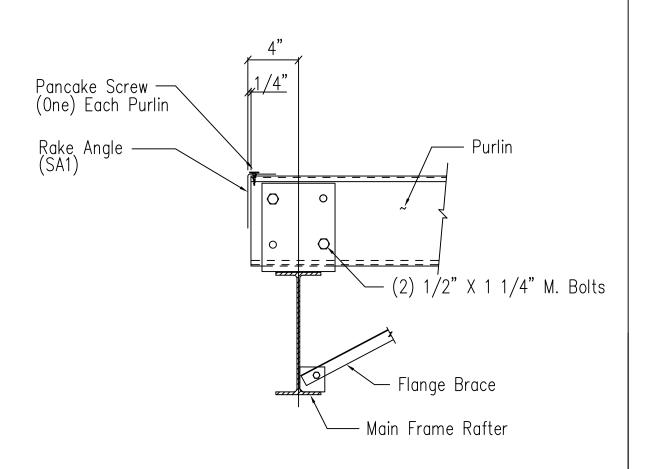


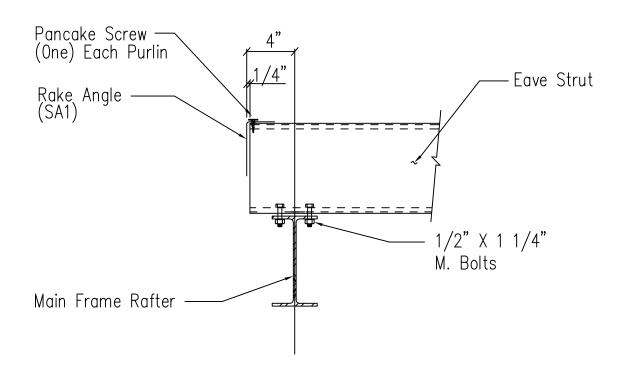


Main Frame Rafter Connection

PURLIN & EAVE STRUT CONNECTION

DRAWING NO.

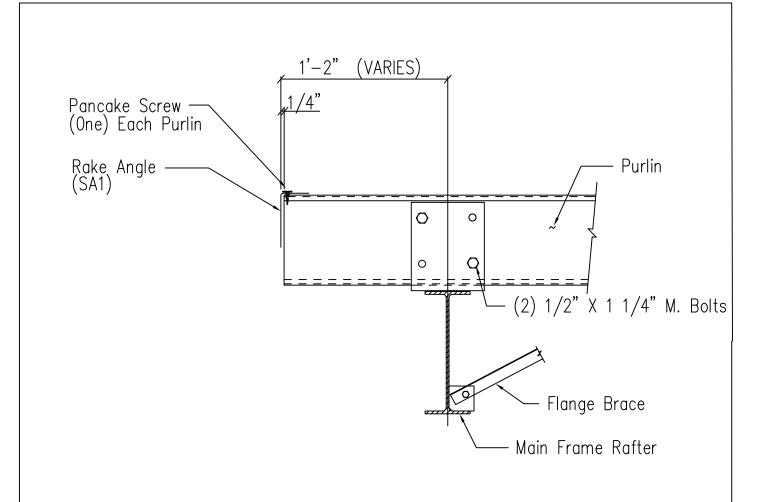


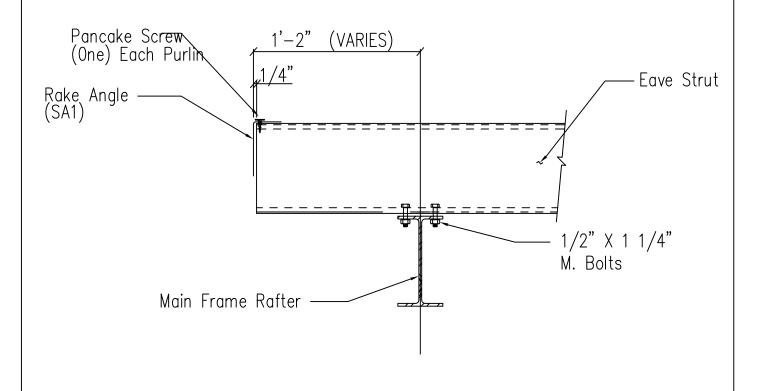


Main Frame Rafter Connection

PURLIN & EAVE STRUT CONNECTION

DRAWING NO.

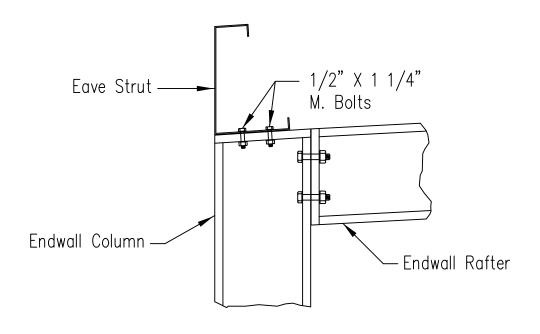


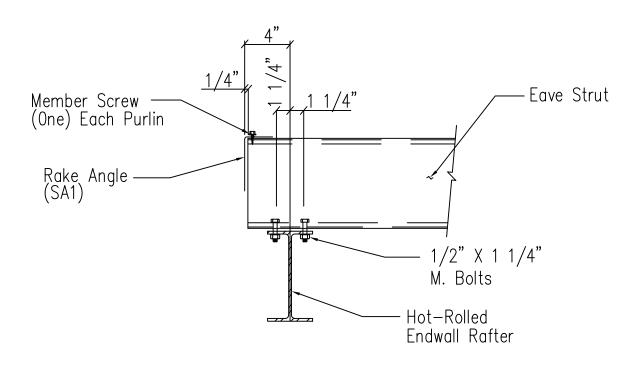


Corner Column Connection WF Rafter/Column

Flush Sidewall


DRAWING NO.

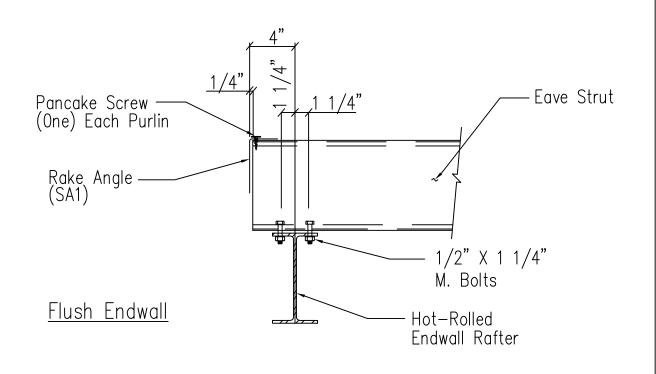

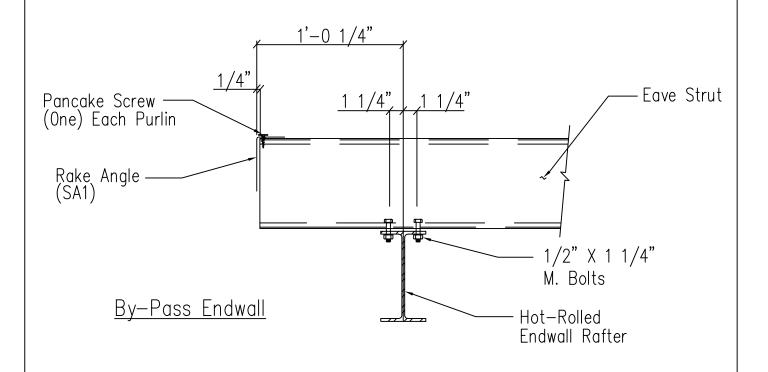



Eave Strut to Hot Rolled Rafter Connection

DRAWING NO.

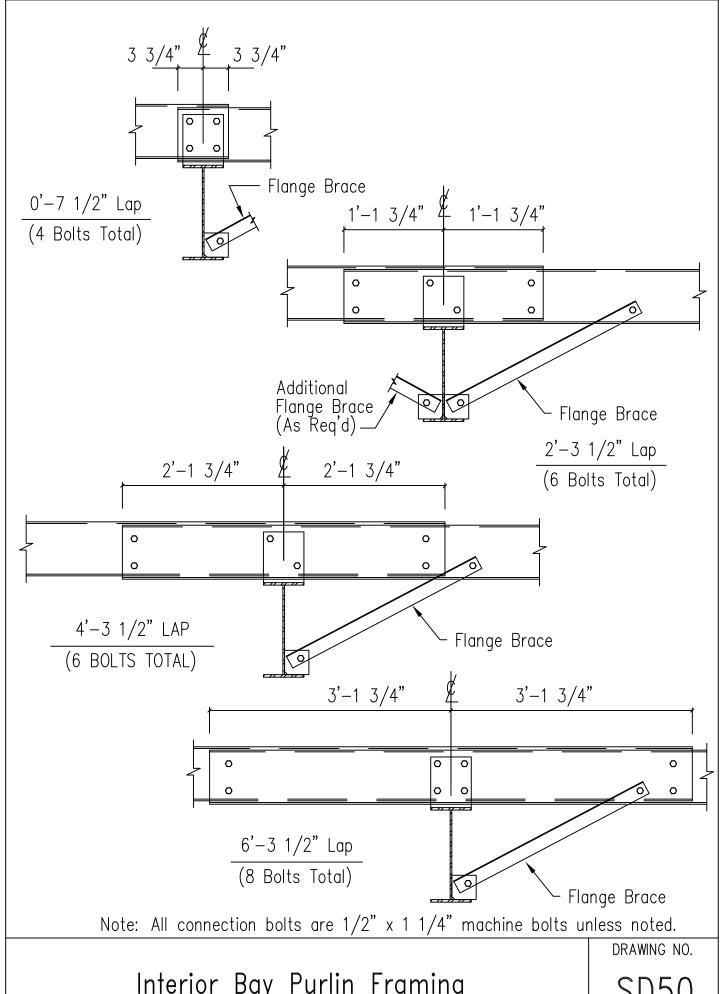

Interior Bay Purlin Framing

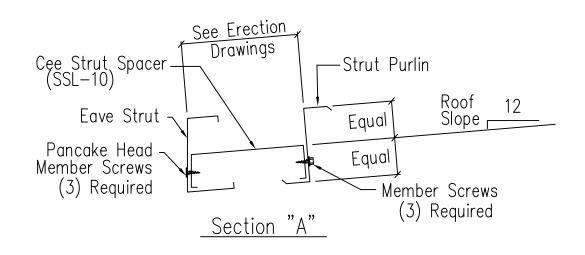


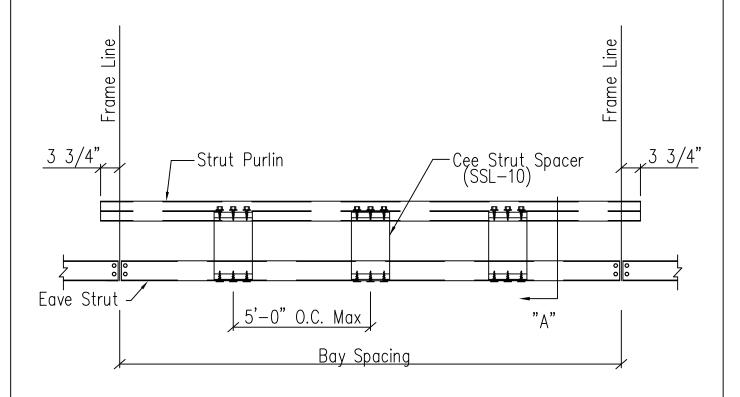

Strut Purlin and Spacer Detail

Low Eave

DRAWING NO.

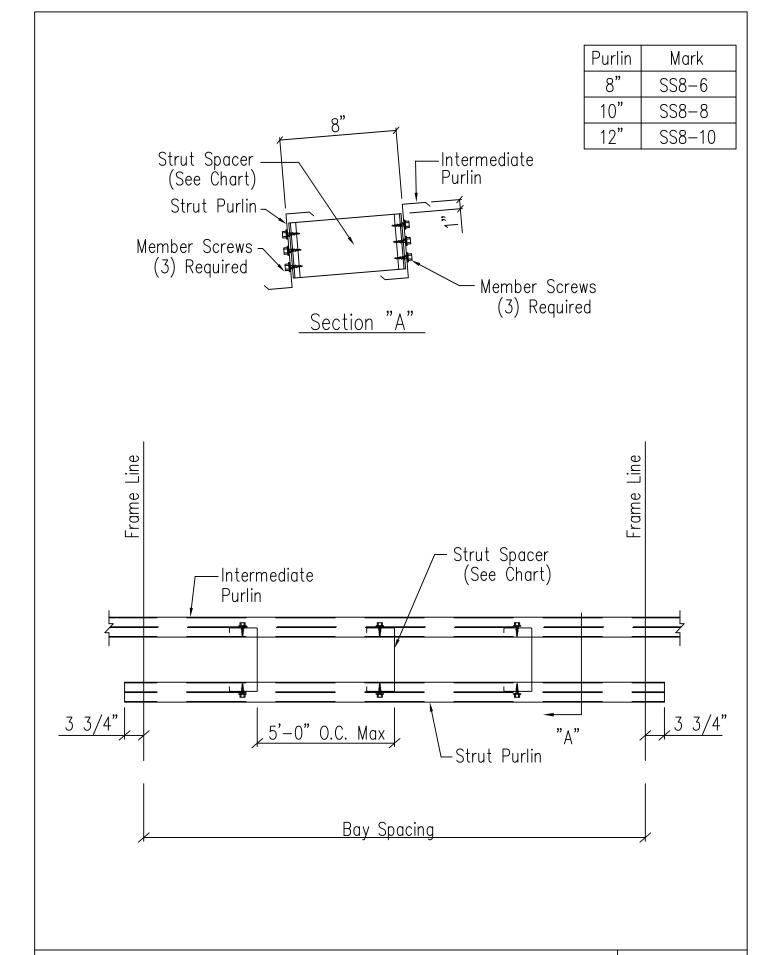


Strut Purlin and Spacer Detail


Interior

Created On: 7/27/12

DRAWING NO.

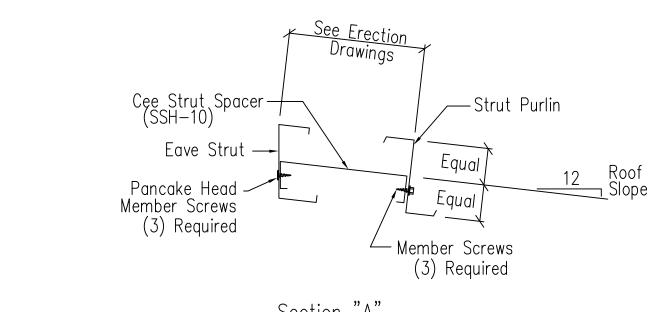


Section "A"

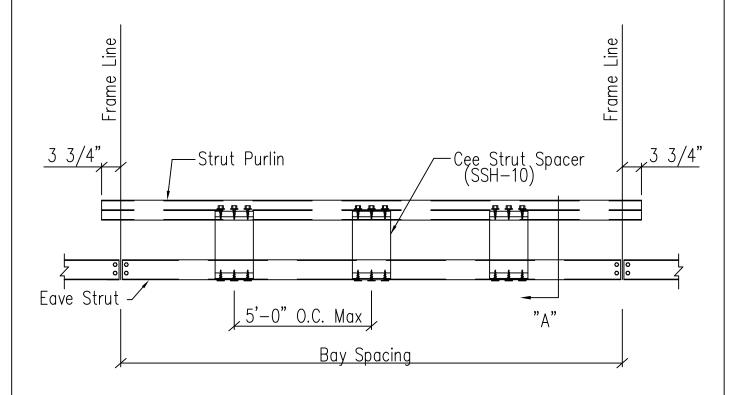

Strut Purlin and Spacer Detail


High Eave

DRAWING NO.

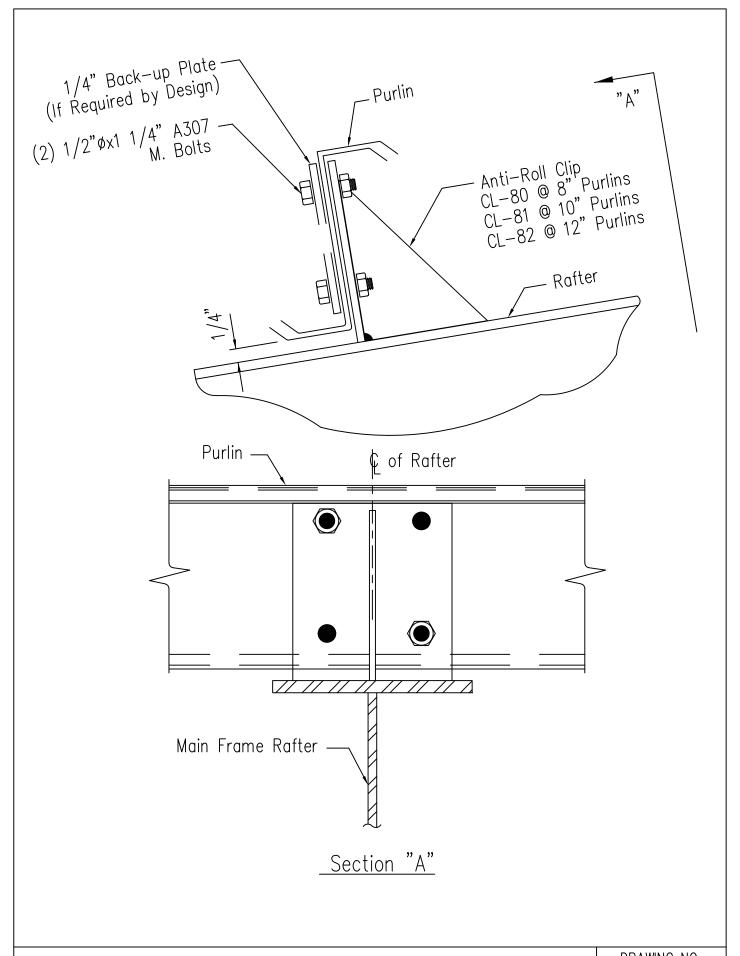


Purlin to Anti-Roll Clip Connection

DRAWING NO.

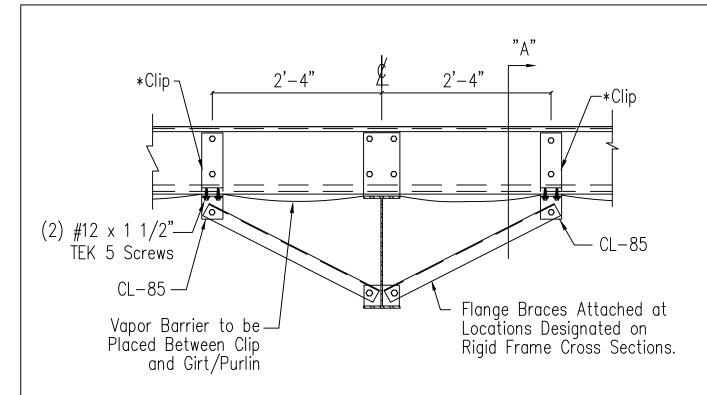

*Clip Table	
8" Girt/Purlin	CL-86
10" Girt/Purlin	CL-87
12" Girt/Purlin	CL-88

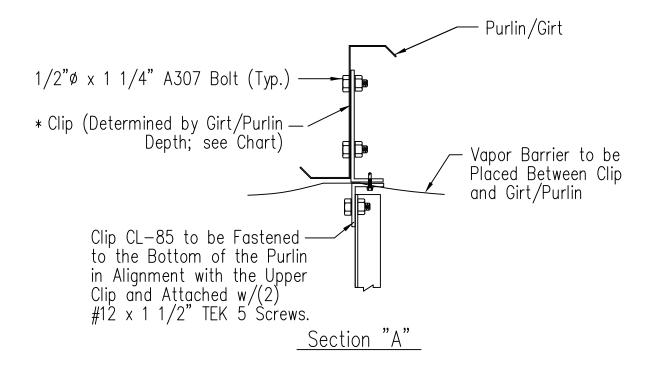


Note: All connection bolts are 1/2" x 1 1/4" machine bolts unless noted.


Interior Girt/Purlin Flange Brace Attachment for Insulation

DRAWING NO.

SD161

Revised On: 01/04/18 Created On: 8/26/11

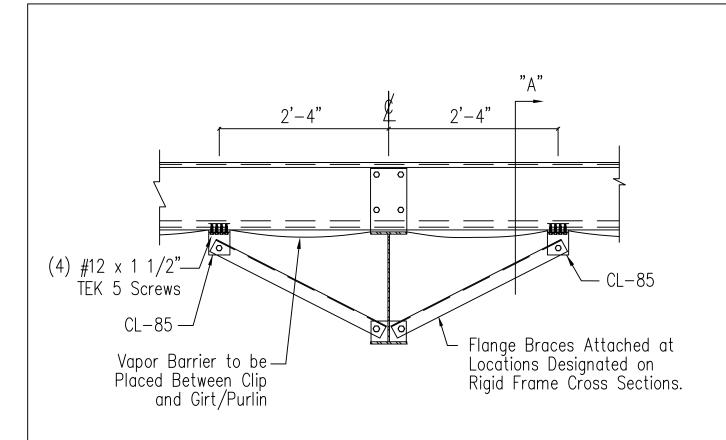

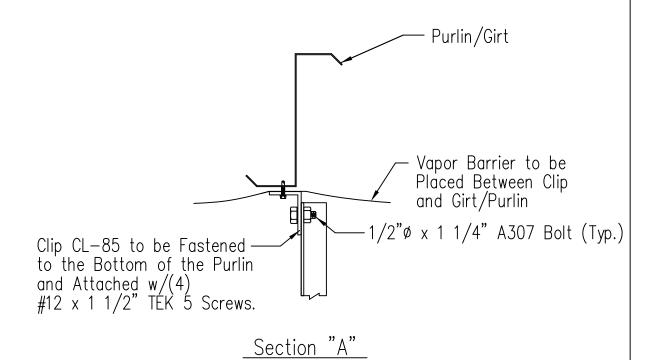


Note: All connection bolts are 1/2" x 1 1/4" machine bolts unless noted.

Interior Girt/Purlin Flange Brace Attachment for Insulation

DRAWING NO.

SD162


Revised On: 01/14/24 Created On: 8/26/11

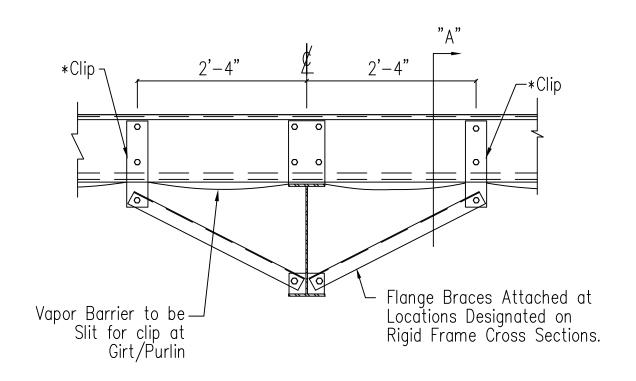

ERECTOR NOTE:

When installing liner panels precut slits in liner panel before hanging overhead.

*Clip Table	
8" Girt/Purlin	CL-22
10" Girt/Purlin	CL-24
12" Girt/Purlin	CL-34

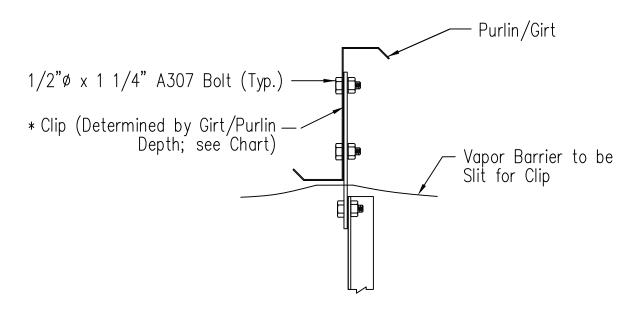

Section "A"

Note: All connection bolts are 1/2" x 1 1/4" machine bolts unless noted.

Interior Girt/Purlin Flange Brace Attachment for Insulation

DRAWING NO.

SD163

Revised On: 02/08/24 Created On: 8/26/11